



Report No. A223036066110103 Page 1 of 4

Company Name

GRADCONN LTD

Shown on Report

209 MINSHENG ROAD, LONGTAN DISTRICT, TAOYUAN CITY,

Address TAIWAN 32554

The following sample(s) and sample information was/were submitted and identified by/on the behalf of the client

Sample Name SMA Bulkhead Jack with O-ring

Type RFCT-SMA122-F13

Sample Receiving State Normal

Sample Received Date Jul. 20, 2023

Testing Period Jul. 20, 2023-Jul. 31, 2023

**Test Requested** 

No.	Test Item
1	IP6X

**Test Result(s):** Please see the following pages.

ved Signatory

ternational Group Co., Ltd.

Approved by

Date

Jul. 31, 2023

No. R1DC483026 Hongwei Industrial Zone, Bao'an 70 District, Shenzhen, Guangdong, China



A223036066110103 Report No.

Page 2 of 4

## Tested Sample(s)

Sample No.	Sample Name	Туре	Quantity
A2230360661101001	SMA Bulkhead Jack	RFCT-SMA122-F13	1pc
	with O-ring		

## Sample Photo(s)



A2230360661101001





Report No. A223036066110103 Page 3 of 4

Test Item: IP6X

### 1. Test Equipment

Equipment Name	Model	
IP4X test finger	SHQG-D1N	
Dust Tester	KXT1410	

#### 2. Environmental Conditions

Temperature:25.3°C; Humidity:57% RH

3. Test Standard: IEC 60529:2013

#### 4. Test Condition

Use a test probe with a diameter of 1mm to probe the gap part of the sample with a force of 1N Put the sample in a negative pressure state, the pumping rate is 40-60 times the volume of the shell per hour, and the pressure difference between the pressure in the shell and the atmospheric pressure is less than 2kPa, and the test is continuously performed for 2h in the dust-proof test box.

#### 5. Test Result(s)

Sample No.	Criterion	Test result (Visual inspection)	Conclusion
A223036066 1101001	The test probe cannot enter the interior of the sample, and there is no dust entering the interior of the sample.	The test probe did not enter the interior of the sample, and there was no dust entering the interior of the sample.	Pass

を Seleco, Lio 章 Nices




Report No. A223036066110103


Page 4 of 4

## Test Photo(s)



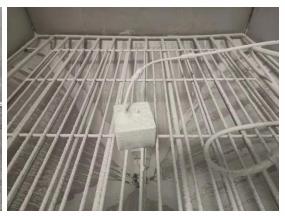

### Sample Photo(s) after the test

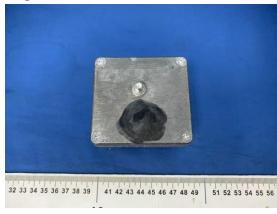



A2230360661101001

A2230360661101001

Remark: The testing data and result(s) in this report is(are) just for scientific research, education, internal quality control and product development etc.

#### Statement:

- 1. This report is considered invalid without approved signature, special seal and the seal on the perforation;
- 2.Company Name and Address shown on Report, the sample(s) and sample Information was/were provided by the applicant who should be responsible for the authenticity which CTI hasn't verified;
- 3. The result(s) shown in this report refer(s) only to the sample(s) tested;
- 4. Without written approval of CTI, this report can't be reproduced except in full;
- 5.In case of any discrepancy between the English version and Chinese version of the testing reports(if generated), the Chinese version shall prevail.

\*\*\* End of Report \*\*\*